


fig. 1

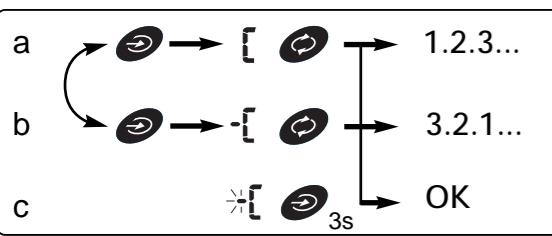

tab. 1

ENGLISH

■ Front panel and value setup (fig. 1)
In the measurement mode: press the key 1 to scroll the measurement pages. press the key 2 to scroll the information pages of the instrument. Holding the button 2 pressed for at least 3 sec., you access parameter programming and setting.
In the programming mode: press the key 1, to scroll the menus or increase/decrease the values to be set up. With button 2 you can enter the submenus and change the value change mode from positive to negative or vice versa according to the logic indicated in table 1: a, pressing button 2, the letter C appears in the bottom row, indicating the possibility to change the values increasing them by means of button 1. b, pressing again button 2, -C appears in the bottom row, indicating the possibility to decrease the values by means of button 1. c, To confirm the selected value, hold button 2 pressed until the mark - of letter C disappears. This way, the value is confirmed.

The frontal red LED (3, fig.1) flashes proportionally to the active imported energy consumption.
Wrong phase sequence indicator (4, fig 1), the hazard triangle is displayed in case of wrong phase sequence (L2-L1-L3, L1-L3-L2).

■ PROGRAMMING BLOCK

It is possible to block the access to programming by means of a specific trimmer positioned on the rear of the removable display unit. Turn the trimmer clockwise up to its run end with the help of a suitable screwdriver as shown in figure 2 point 5.

■ BASIC PROGRAMMING AND RESET

To enter the complete programming mode, press the key 2 for at least 3 sec. (fig 1). Entering the programming mode, all the measurements and control functions are inhibited. During this phase the flashing of the LED has not to be considered.

01 PASS?: entering the right password (default value is 0) allows accessing the main menu.

02 ChGPASS: it allows changing the password.

03 APPLIC: it allows selecting the pertinent application. A: active positive energy meter (measuring of active positive energy and some minor parameters). B: active and reactive positive energies meter (measuring of energies active and reactive positive with some minor parameters). C: showing of all the electrical variables available.

04 SYS: it allows selecting the electrical system. 3Pn: 3-phase unbalanced with neutral; 3P: 3-phase unbalanced without neutral; 3P1: 3-phase balanced with or without neutral 2P: 2-phase; 1P: single phase.

05 Ut rAt: VT ratio (1.0 to 6.00k). Example: if the connected VT primary is 5kV and the secondary is 100V, the VT ratio to be set is 50 (that is 5000/100).

06 PulSE: selects the pulse weight (kWh per pulse; programmable from 0,01 to 9,99).


07 P.tEST: sets the simulated power value (kW) to which a proportional pulse sequence according to "PULSE" corresponds. The function is active until you remain within the menu.

08 tEST: activated on the pulse output when ON (for "APPLIC" Only).

09 Add.: serial address: from 1 to 247 (with "IS" option only).

10 EnErES: reset of all the meters (for "APPLIC" Only).

11 End : it allows exiting the programming mode by pressing the key 2 (see fig 1).

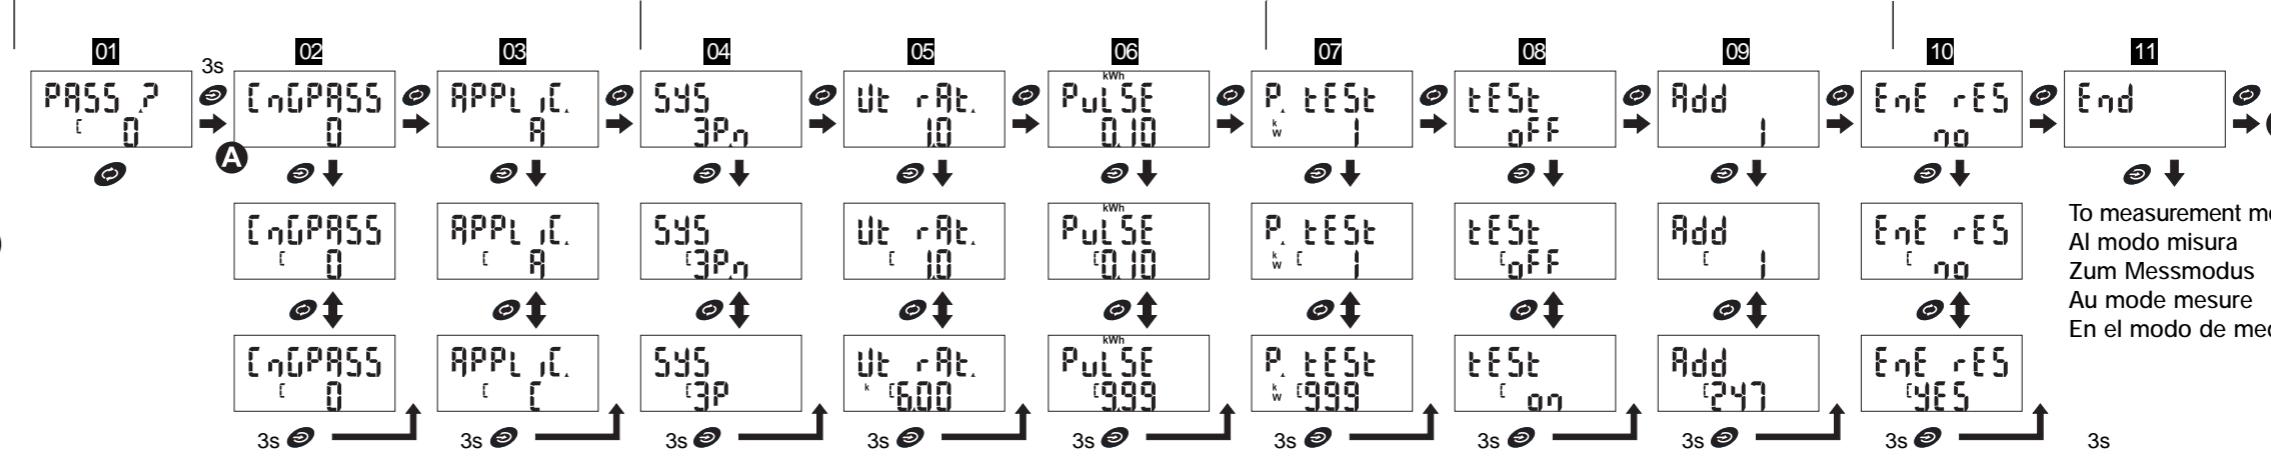

To measurement mode
Al modo misura
Zum Messmodus
Au mode mesure
En el modo de medición

SUOMI

Etupanelia arvojen asetus (kuva. 1)

Mittauista: painike 1, selataan mittaustietoja. Painike 2, selataan mittarin informaatiotilaa.Ohjelointitilaan pääsee painamalla painiketta 2 vähintään 3s. ajan.

Ohjelointitila: Painike 1, selataan valikoita tai suur./pienennetään asetuksen lukuarvoja Painike 2, pääsee alivalikoihin ja vaihdetaan arvomuutos positiiviseksi tai negatiiviseksi tai päärvastoin taulukossa 1 esitettyä tavalla: a, paina painiketta 2, kirjain C tulee näytön alariville osoittamaan mahdollisuutta kasvattaa arvoa painamalla painiketta 1. b, jos painat uudest. painiketta 2, -C tulee näytön alariville osoittamaan mahdollisuutta vähentää arvoa painamalla painiketta 1. c, valitut arvo vaihvistetaan painiketta 2 ja alas painettuna kunnas - merkki C edestä poistuu. Tällä tavalla arvo on vaihvistettu.

Etupanelin punainen LED (3, kuva.1) vilkkuu verrannollisena kulutettuun energiaan.

Vääärän vaihejärjestyksen näyttö (4, kuva 1), varoituskolm. ollessa (L2-L1-L3, L1-L3-L2).

■ OHJELMOINNIN ESTO

Ohjelointitilaan pääsy voidaan estää irroittavan näytön takana olevalla kiertokytkimellä. Kierrä kytkintä sopivalla ruuvimeissellillä myötäpäivään kunnes se ei enää liiku, kuten kuvassa 2 kohdassa 5 on esitetty.

■ PERUSOHJELMOINTIJANOLLAUS

Ohjelointitilaan päästäan painamalla painiketta 2 vähintään 3s. ajan (kuva 1). Ohjelointitilassa kaikki mittaus- ja valvontatoiminnot ovat pois toiminnasta.

Tässä tilassa LED:n vilkuminen ei ole yhteydessä kulutettuun energiaan

01 PASS?: annetaan voimassa oleva salasana, (oletus on 0), sallii pääsyn päävalikkoon

02 ChGPASS: salasanen vaihto.

03 APPLIC: sopivan sovellutuksen valinta A: pätöenergiamittari (mittaa tuuden pätöenergian ja muutaman perusluvun).

B: pätö- ja loisenergiamittari (mittaa tuuden pätö- ja loisenergian ja muutaman perusluvun.). C: näyttää kaikki saatavissa olevat sähköiset suureet.

04 SYS : sähköverkon tyypin valinta: 3Pn: 3-vaih.epäsymm.verkko+N; 3P: 3-vaih.epäsymm.verkko ilman N ; 3P1: 3-vaih.symm.verkko joko N tai ilman N; 2P: 2-vaih.verkko; 1P: 1-vaih.verkko

05 Ut rAt: : JM muuntosuhde (1,0 - 6,00k). Esim: jos ensiöjännite on 5kV ja toisijännite 100V , jännitemuuntajan muuntosuhdeksi asetetaan 50 (joka lasketaan: 5000/100).

06 PulSE: määrittelee pulssin arvon (kWh / pulssi; ohjelointivissa 0,01 - 9,99).

07 P.tEST: asettaa simuloidun tehon (kW) joka saadaan pulssilähdestä "PULSE" ulos, toiminto on päällä kunnes poistutaan valikosta

08 tEST: (vain sovellutus "APPLIC" C), aktivoi pulssilähdon ON tilassa.

09 Add.: sarjaliikennerointinosite: 1 - 247.(vain "IS" optio)

10 EnErES: nollaa kaikki sovellutukset (vain sovellutus "APPLIC" C).

11 End : paina painiketta 2 (kts. kuva 1) poistut ohjelointitilasta.

DEUTSCH

Vorderes Bedienfeld und Werteinstellungen (fig. 1)

Im Messmodus: Taste 1, durchblättert die Messseiten. Taste 2 durchblättert die Informationsseiten des Geräts. Bei Gedrückthalten der Taste 2 für mindestens 3 Sek. loggen Sie sich in die Programmierung und Parametereinstellungen ein.

Im Programmiermodus: Taste 1 durchblättert die Menüs bzw. erhöht/verringert die einzustellenden Werte. Mit Taste 2 gelangt man in die Untermenüs und ändert die Zunahmemodalität der Werte von positiv in negativ und umgekehrt je nach der in Tabelle 1 angegebenen Logik: a, bei Drücken der Taste 2 wird ein Buchstaben C in der unteren Zeile angezeigt, der die Möglichkeit aufzeigt, die Werte mit der Taste 1 zu steigern. b, bei weiterem Drücken der Taste 2 wird -C in der unteren Zeile angezeigt, was die Möglichkeit aufzeigt, die Werte mit der Taste 1 zu verringern. c, Zur Bestätigung des gewählten Werts die Taste 2 so lange gedrückt halten bis das Zeichen – des Buchstabens C erscheint, dadurch wird der Wert bestätigt. Die vordere rote LED-Leuchte (3, vfig.1) blinkt, wenn die gemessene Wirkenergie und der Strom positiv (importiert) sind.

Anzeige von falscher Phasenfolge (4, fig 1), das Gefahrendreieck wird bei falscher Phasenfolge angezeigt (L2-L1-L3, L1-L3-L2).

■ SPERRE DER PROGRAMMIERUNG

Der Zugriff auf die Programmierung kann mit einem entsprechenden auf der Rückseite der entfernbarer Anzeigeneinheit positionierten Trimmer blockiert werden. Den Trimmer mithilfe eines passenden Schraubenziehers, wie auf Abb. 2 Punkt 5 dargestellt, im Uhrzeigersinn bis zum Anschlag drehen.

■ PROGRAMMIERUNG UND RÜCKSETZEN

Um in den Programmiermodus zu gelangen, muss die Taste 2 für mindestens 3 Sek. gedrückt werden (siehe Abb.1). Im Programmiermodus werden alle Mess- und Kontrollfunktionen inaktiv. Diese Phase hat keinen Bezug zu dem Blinken der LED.

01 PASS?: : durch Eingabe des richtigen Passworts (Default-Wert beträgt 0) rufen Sie das Hauptmenü auf.

02 ChGPASS: ermöglicht Passwortänderung.

03 APPLIC: ermöglicht die Wahl des entsprechenden Applikationsbereichs. A: Wirkenergiezähler (Messen der positive Wirkenergie und einiger weniger Parameter). B: Wirk- und Blindenergiezähler (Messen der positive Wirk- und Blindenergien mit einigen weniger Parametern). C: Anzeige aller verfügbaren elektrischen Messgrößen.

04 SYS : ermöglicht die Wahl des Elektrosystems. 3Pn: 3-phäsig unsymmetrisch mit Nullleiter, 3P: 3-phäsig symmetrisch ohne Nullleiter, 3P1: 3-phäsig symmetrisch mit oder ohne Nullleiter 2P: 2-phäsig, 1P: eine Phase.

05 Ut rAt: : JM muuntosuhde (1,0 - 6,00k). Beispiel: Wenn der ange-

schlossene primäre Spannungswandler 5kV beträgt und der sekundäre 100V, beträgt das einzustellende Spannungswandlerverhältnis 50 (d.h. 5000/100).

06 PulSE wählt das Impulsge wicht (kWh pro Impuls; einstellbar von 0,01 bis 9,99).

07 P.tEST: (NUR MIT "APPLIC" C Option, siehe Menü n. 3), stellt den simulierten Leistungswert (kW) ein, dem eine Frequenz der zu ihr proportionalen Impulse auf der Grundlage von "PULSE" entspricht, die Funktion ist eingeschaltet solange Sie im Menü bleiben.

08 tEST: (NUR MIT "APPLIC" C Option, siehe Menü n. 3), bei ON ist Impulsausgang eingeschaltet.

09 Add.: (nur mit "IS" Option) ermöglicht die Wahl der seriellen Gerätadressen (von 1 bis 247).

10 EnErES: ermöglicht das Rücksetzen der Gesamtenergiezähler (NUR MIT "APPLIC" C).

11 End : ermöglicht das Verlassen des Programmiermodus durch Drücken der Taste 2 (siehe Abb. 1).

FRANÇAIS

Panneau frontal et configurations valeurs (fig. 1)

En mode mesure: touche 1, les pages de mesure défilent. Touche 2, les pages d'informations de l'instrument défilent. En maintenant enfonce pendant au moins 3 sec. la touche 2, on accède à la programmation et configurations paramètres.

En mode programmation: touche 1, les menus défilent ou les valeurs à configurer augmentent/baissent. La touche 2 entre dans les sous-menus et change le mode d'incrémentation des valeurs de positif à négatif et vice-versa selon la logique reportée dans le tableau 1: a, en appuyant sur la touche 2, la lettre C apparaît sur la ligne inférieure indiquant la possibilité d'actionner sur les valeurs en les augmentant à l'aide de la touche 1. b, en appuyant encore sur la touche 2, C apparaît dans la ligne inférieure indiquant la possibilité d'agir sur les valeurs en les diminuant à l'aide de la touche 1. c, Pour valider, confirmer la valeur sélectionnée, maintenir la touche 2 jusqu'à ce que le signe – de la lettre C disparaît, la valeur sera ainsi confirmée.

La LED rouge frontale (3, fig.1) clignote proportionnellement à l'énergie active mesurée.

Indicateur de séquence phase erronée (4, fig 1), le triangle de danger est affiché en cas de séquence de phase erronée (L2-L1-L3, L1-L3-L2).

■ BLOQUEO DE LA PROGRAMMACIÓN

Es posible bloquear el acceso a la programación mediante el conmutador situado en la parte trasera del módulo display. Gre en sentido horario el conmutador hasta su tope usando un destornillador adecuado como muestra la fig. 2 punto 5.

■ PROGRAMACIÓN Y PUESTA A CERO

Para entrar al modo de programación completo hay que pulsar la teda 2 al menos 3 seg. (ver fig. 1). En el modo de programación completa del instrumento, todas las medidas y las funciones de control están inhibidas. Durante esta fase el parpadeo del LED no debe ser considerado.

01 PASS?: : introduciendo la clave correcta (valor por defecto 0) se accede al menú principal.

02 ChGPASS: permite cambiar la clave.

03 APPLIC: permite seleccionar la aplicación correspondiente. A: activar el contador de energía positiva (midiendo la energía activa positiva y algunos parámetros menores). B: contador de energía activa positiva y reactiva positiva (midiendo la energía activa y reactiva positiva con algunos parámetros menores). C: muestra todas las variables eléctricas disponibles.

04 SYS : Permite seleccionar el sistema eléctrico. 3Pn: trifásico desequilibrado con neutro; 3P: trifásico desequilibrado sin neutro; 3P1: trifásico equilibrado con o sin neutro; 2P: bifásico; 1P: monofásico.

05 Ut rAt: : relación del tráfico de tensión VT (1,0 a 6,00k). Ej.: si el primario del tráfico conectado es 5kV y el secundario es 100V, la relación del tráfico de tensión es 50 (es decir, 5000/100).

06 PulSE: selecciona el valor del pulso (kWh por pulso; programable de 0,01 a 9,99).


07 P.tEST: (SÓLO CON "APPLIC" C, ver menú n. 3), configura el valor de potencia simulada (kW) a la que corresponderá una frecuencia de los pulsos proporcional a ésta en base a "PULSE". La función está activa mientras se permanece en el menú.

08 tEST: (SÓLO CON "APPLIC" C, ver menú n. 3), activado en la salida de pulsos cuando se selecciona ON.

09 Add.: (sólo opción IS') permite seleccionar la dirección serie del instrumento: de 1 a 247.

10 EnErES: permite la puesta a cero de todos los contadores totales (SÓLO CON "APPLIC" C).

11 End: permite salir del modo de programación pulsando la teda 2 (ver fig. 1).

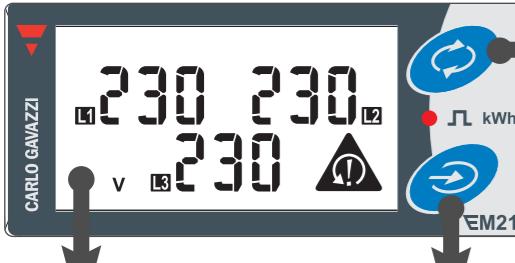



In case of wrong phase sequence.
Vääärä vaihejärjestys, osoitus.
Bei falscher Phasenfolge.
En cas de séquence phases erronée.
En caso de secuencia de fase incorrecta.



Phase to phase voltage
L1-2, L2-3, L3-1.
Vaihe-vaihe jännite
L1-2, L2-3, L3-1.
Spannung Phase-Phase
L1-2, L2-3, L3-1.
Tension phase-phase
L1-2, L2-3, L3-1.
Tensión entre fases
L1-2, L2-3, L3-1.




System values.
Verkko/järjestelmä arvot
Systemwerte.
Valeurs de système.
Valores del sistema.

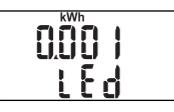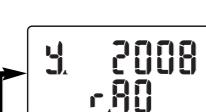



Year of production (Y. 2008) and firmware release (r.A0).
Valmistusvuosi (Y. 2008) ja ohjelmistoversio (r.A0).
Herstellungsjahr (Y. 2008) und Version der Firmware (r.A0).
Année de production (Y. 2008) et version firmware (r.A0).
Año de fabricación (Y. 2008) y versión del firmware (r.A0).

kWh per pulse (LED).
kWh / pulssi (LED).
kWh pro Impuls (LED).
kWh par impulsion (LED).
kWh por pulso (LED).

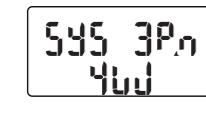


Type of system (SYS 3Pn) and type of connection (4 wires).
Verkon tyyppi (SYS 3P.n) ja kytkentä (4-johdin).
Systemtyp (SYS 3P.n) und Anschlusstyp (4 Adern).
Type de système (SYS 3P.n) et type de branchement (4 câbles).
Tipo de sistema (SYS 3P.n) y tipo de conexión (4 hilos).

Primary current transformer value.
Virtamuumantajan muuntosuhde.
Stromwandler-Verhältnis.
Ratio de transformateur ampèremètre.
Relación del transformador de corriente.

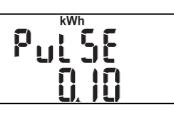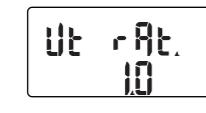


Voltage transformer ratio.
Jännitemuuntajan (JM) muuntosuhde.
Spannungswandler-Verhältnis.
Ratio de transformateur de tension.
Relación del transformador de tensión.

Pulse output: kWh per pulse.
Pulssilähtö: kWh / pulssi.
Impulsausgang: kWh pro Impuls.
Sortie impulsions: kWh par impulsion.
Salida pulsos: kWh por pulso.

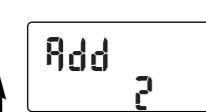


Serial communication address.
Sarjaliikenneportin osoite.
Serielle Kommunikationsadresse.
Adresse de communication serial.
Dirección de comunicación serie.

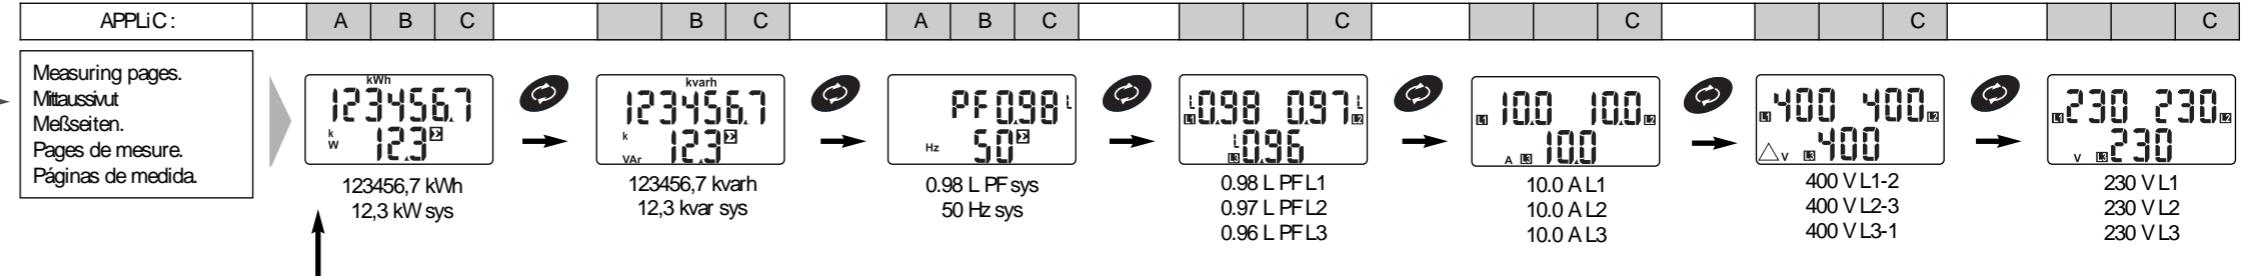

Available variables only with RS485.
Saatavana vain RS485 kanssa.
Vorhandene Variablen nur mit RS485.
Variables disponibles seulement avec RS485.
Variables disponibles sólo con RS485.

VL-N sys, VL-L sys, VA sys, VA L1, VA L2, VA L3, var L1, var L2, var L3, WL1, WL2, W L3.

A

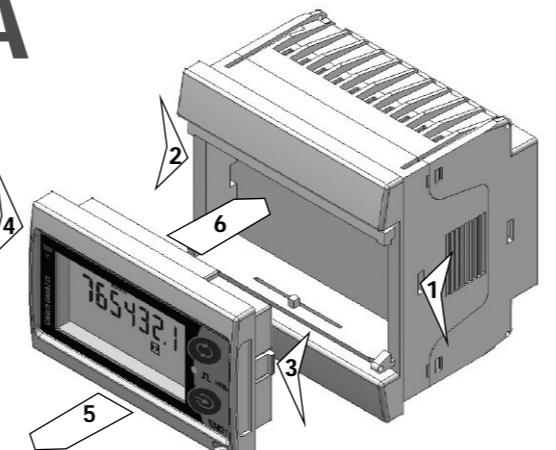

ENGLISH

■ Transforming the instrument from DIN guide fitting to panel fitting and vice versa.

To remove the display unit, by means of a screwdriver of suitable dimensions, operate on slots (1 and 2) on the sides of the instrument, pressing the fastening tabs (3 and 4), then carefully remove (5) the display unit.

To transform the instrument from panel fitting to DIN guide fitting, rotate the measurement base from A to B.

To transform the instrument from DIN guide fitting to panel fitting, rotate the measurement base from B to A.

To insert the display unit, gently push it (6) in its seat, as shown in the images, until you hear the "clicks" of the elastic tabs (3 and 4) which signal the correct fitting in the slots (1 and 2).

■ Green LED, fig. C1

If the instrument is used as converter, that is without display unit, the green LED shows that the instrument is powered, if the LED flashes, it shows that the instrument is connected to the serial network and is communicating.

SUOMI

■ Laitteen muuttaminen Din-kiskoasennuksesta kansiasennukseen ja päinvastoin.

Näytön irroitus tapahtuu laitteen sivuilla oleviin koloihin (1 ja 2) sopivalla ruuvimeissellillä. Paina kiinnityssalpoja (3 ja 4) ruuvimessellillä ja vedä (5) samanaikaisesti näyttöä ulospäin.

Muutos kansiasennuksesta DIN-kiskoasennukseen,

käännä mittarin runko asennosta A asentoon B.

Muutos DIN-kiskoasennuksesta kansiasennukseen,

käännä mittarin runko asennosta B asentoon A.

Näytön asennus, paina (6) varovasti näyttö paikoilleen, kuten skuvassa on esitetty, kunnes kuulet "klick" äänen kiinnityssalpojen (3 ja 4) asettuaan kohdalleen aukkoihin (1 ja 2). Tämä takaa näytön oikein asetumisen paikoilleen.

■ Vihreä LED, kuvा. C1

Jos laitteita käytetään lähettimenä, ilman näyttöä, vihreä LED näyttää että laitteessa on jännite. Jos LED vilkkuu, se tarkoittaa että laitteessa on sarjaliikenreportti kytkettynä.

DEUTSCH

■ Umwandlung der Gerätemontage von DIN Schiene in Tafel und umgekehrt.

Zur Herausnahme der Anzeigeeinheit, mit einem entsprechend großen Schlitzschraubenzieher durch die Ösen (1 und 2) an den Seiten des Geräts auf die Befestigungszungen (3 und 4) drücken und dann die Anzeigeeinheit vorsichtig herausziehen (5).

Zur Umwandlung der Gerätemontage von Tafel in DIN Schiene, die Messbasis um sich selbst von A auf B drehen.


Zur Umwandlung der Gerätemontage von DIN Schiene in Tafel, die Messbasis um sich selbst von B auf A drehen.

Zum Einsetzen der Anzeigeeinheit, diese (6) vorsichtig in das vorgesehene Gehäuse schieben bis das "Klicken" der elastischen Befestigungszungen (3 und 4) zu hören ist, welches ihr korrektes Einrasten in den Verschlüssen (1 und 2) bedeutet.


■ Grüne LED-Leuchte, Abb. C1

Wenn das Gerät als Wandler verwendet wird, also ohne Anzeigeeinheit, zeigt die grüne LED-Leuchte die vorhandene Speisung an, bei ihrem Blinken zeigt die LED-Leuchte auch an, dass das Gerät an ein serielles Netz angeschlossen ist und gerade kommuniziert.

B

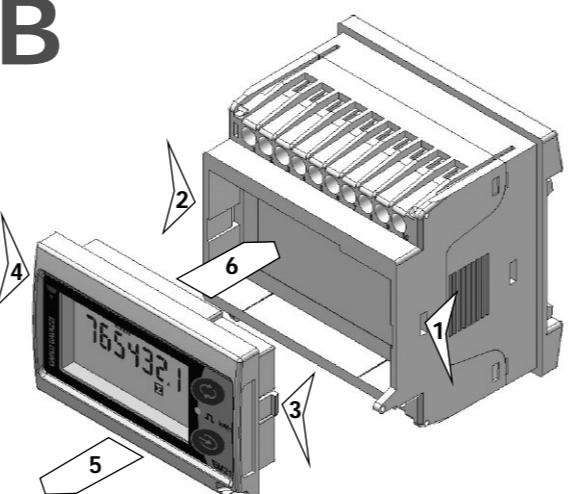

C

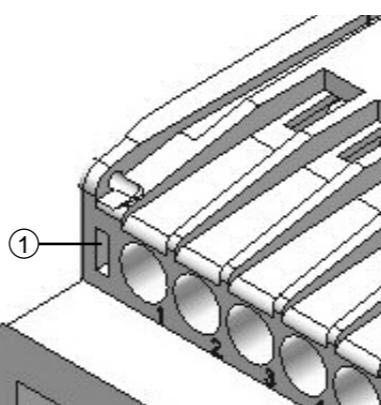

FRANÇAIS

■ Transformer l'instrument de montage en guide DIN en montage à panneau et vice-versa.

Pour enlever l'unité d'affichage, à l'aide d'un tournevis à coupe de dimensions adéquates, actionner les fentes (1 et 2) aux côtés de l'instrument en appuyant sur les languettes de fixation (3 et 4) puis extraire (5) avec soin l'unité display.

Pour transformer l'instrument de montage en panneau à guide DIN, tourner sur elle-même la base de mesure de A à B.

Pour transformer l'instrument de guide DIN à montage en panneau, tourner sur elle-même la base de mesure de B à A.

Pour insérer l'unité d'affichage, la pousser (6) délicatement dans le siège prédisposé comme les images sur le côté l'illustrent jusqu'à ce qu'on avertisse les "clics" des languettes élastiques de fixation (3 et 4) ce qui signifie l'encastrement correct de celles-ci dans les fentes (1 et 2) de fermeture.

■ LED vert, fig. C1

Dans le cas où l'instrument est utilisé en tant que convertisseur et donc sans unité display, le LED vert indique la présence de l'alimentation si le LED clignote, cela indique aussi que l'instrument est branché au réseau série et qu'il communique.

ESPAÑOL

■ Transformar el montaje a carril DIN en montaje a panel y viceversa.

Para retirar el módulo display, mediante un destornillador adecuado, accionar en las ranuras (1 y 2) a los lados del equipo presionando las lengüetas de fijación (3 y 4) y extrayendo (5) con cuidado el módulo display.

Para transformar el montaje en panel a montaje en carril DIN, gire sobre sí misma la base de A a B.

Para transformar el montaje a carril DIN en montaje a panel, gire sobre sí misma la base de B a A.


Para introducir el módulo display, empújelo (6) delicadamente en el hueco correspondiente, como ilustran las imágenes que aparecen a la izquierda, hasta que oiga los "dic" de las lengüetas de fijación (3 y 4) que indican que se han introducido correctamente en los orificios (1 y 2) de cierre.

■ LED verde, fig. C1

En caso de que el equipo se use como convertidor, por lo tanto sin display, el LED verde indica que el equipo está alimentado, si el LED parpadea indica también que el equipo está conectado a la red en serie y que está comunicando.



EM21 72R "3-phase Energy Meter for Retro-fit" TULOT/LÄHDÖT

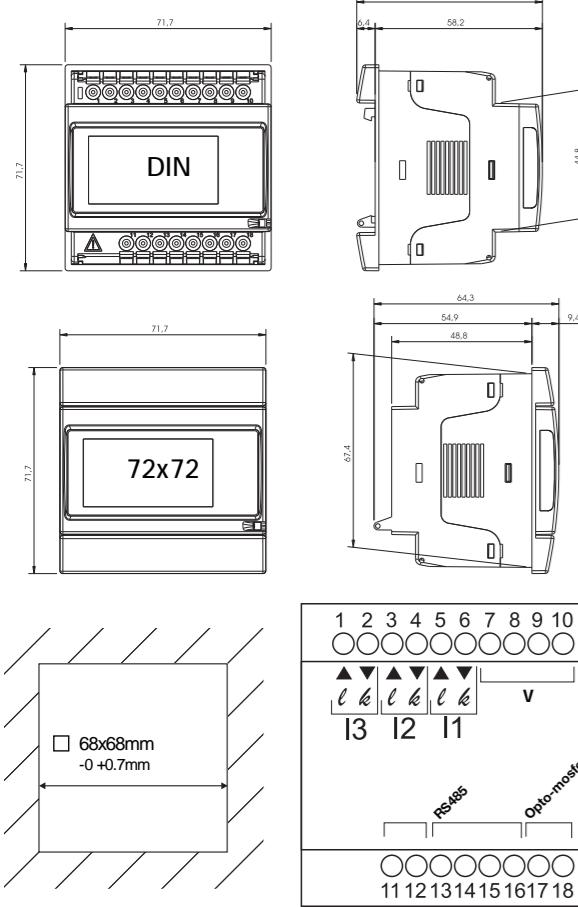


WARNING! Before closing the CT, make sure that the surfaces of the iron core (exposed when the CT is open) of the current transformer are not dirty or damaged. Ensure the proper closure of the CT. Use CT on power cables (primary) with isolation of at least 1500VAC. Arrange the connecting CT cables in a proper way in order to limit electromagnetic coupling noise.

VAROITUS! Ennen VM:n sulkemista, varmista, että rautasydämen pinnat (näkyvät kun VM on avattuna) eivät ole likaiset eivätkä vaurioituneet. Varmista VM:n sulkeminen. Käytä VM:n kaapelin sisällä vain sen omia johtimia, joissa on eristystekijävyyks (ensiö puolella) on 1500VAC. Asenna VM:jien kaapelit niin, ettei sähkömagneettisia häiriöitä syntisi ja tästä mahdollisesti johtuva ääni voidaan välttää.

VORSICHT! Vor dem Schließen der Stromwandler ist sicherzustellen, dass die Oberflächen des Eisenkerns (wenn die CT geöffnet ist) des Stromwandlers nicht verschmutzt oder beschädigt ist. Gewährleisten Sie ein ordnungsgemäßes Schließen der Stromwandler. Verwenden Sie die Stromwandler auf Stromkabel (primär) mit Isolierung von min. 1500VAC. Verlegen Sie die CT Kabel in geeigneter Weise um elektromagnetische Störungen zu vermeiden.

ATTENTION! Afin de fermer le transformateur d'intensité, s'assurer que les surfaces du noyau ferreux (surfaces apparentes lorsque le TI est ouvert) ne sont ni sales ni endommagées. S'assurer de la bonne fermeture du transformateur d'intensité. Utiliser le TI sur des câbles de puissance (primaires) avec une isolation minimale de 1500 VCA. Ordiner les câbles de connexion au mieux pour limiter les bruits électromagnétiques.

¡ADVERTENCIA! Antes de cerrar el trafo de intensidad, asegurarse de que las superficies de su núcleo (expuestas cuando el trafo está abierto) no estén sucias o dañadas. Cerrar bien el trafo de intensidad. Usar el trafo con cables de potencia (primario) con aislamiento de al menos 1500VCA. Realizar la conexión de los cables del trafo de intensidad correctamente para limitar el ruido por acoplamiento electro-magnético.

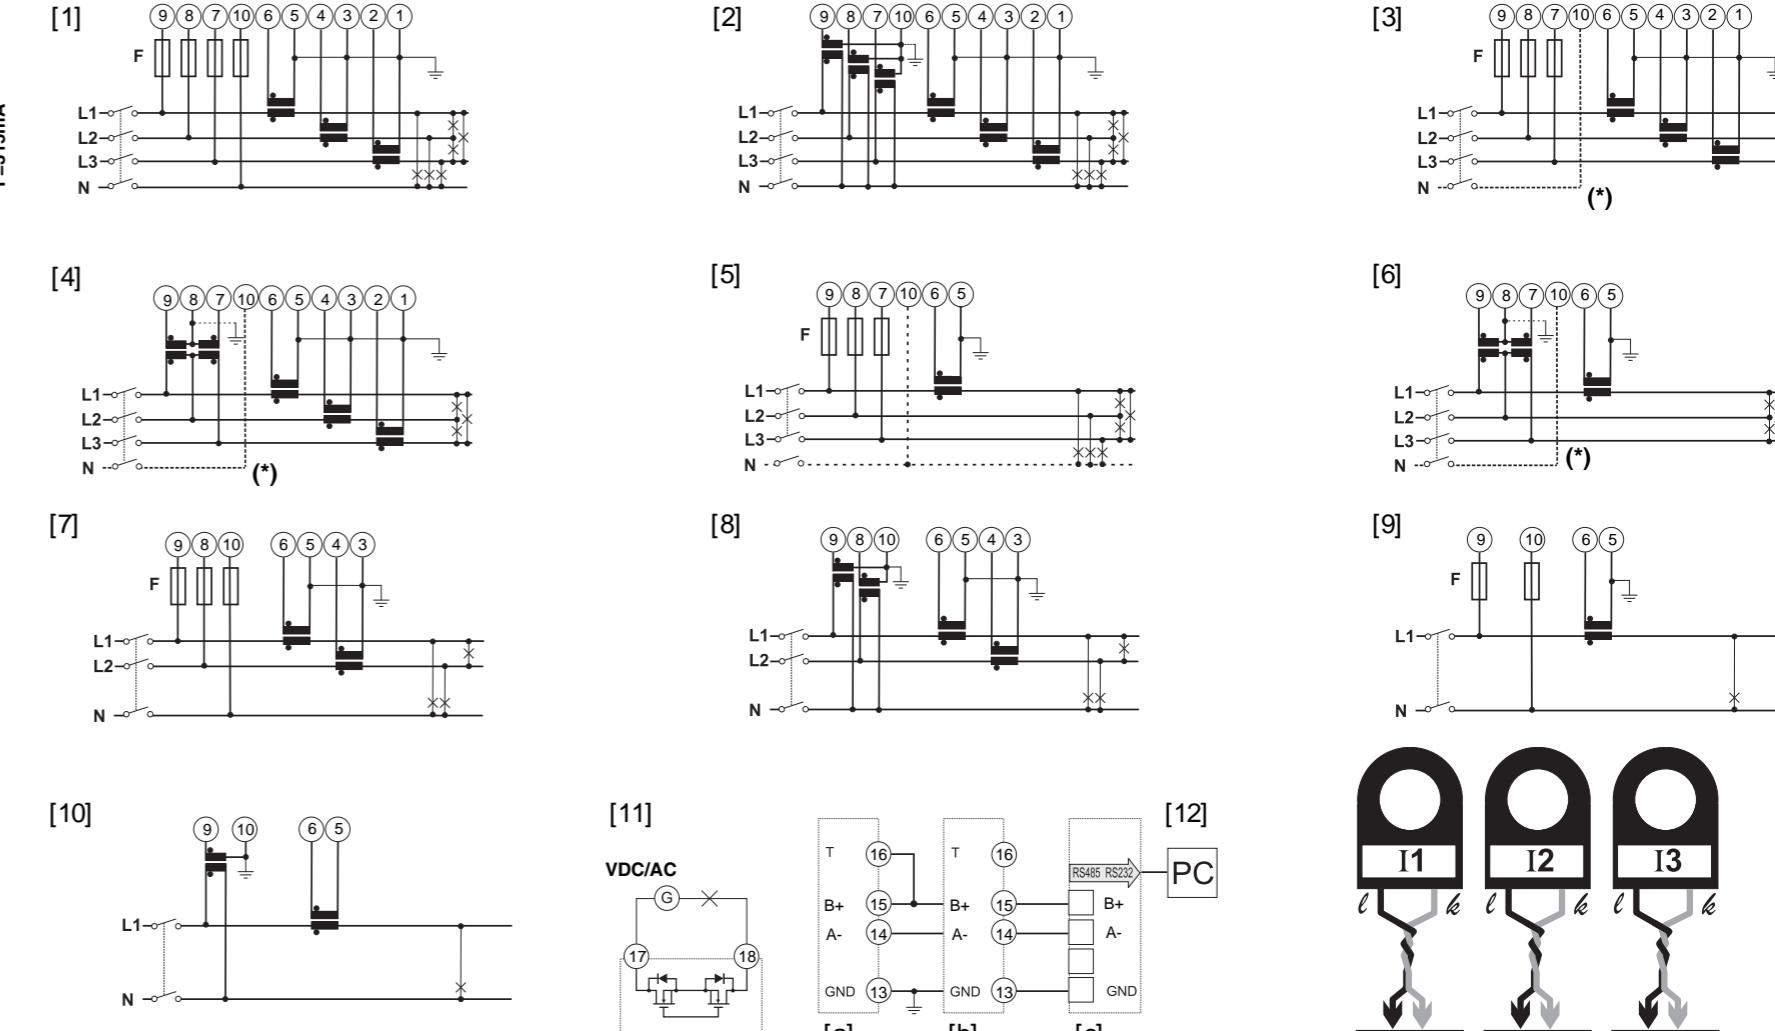

ENGLISH

- 6A System type selection 3P.n
 [1]- 3-ph, 4-wire, unbalanced load, 3-CT connection.
 [2]- 3-ph, 4-wire, unbalanced load, 3-CT and 3-VT/PT connections
 6A System type selection 3P
 [3]- 3-ph, 3-wire, unbalanced load, 3-CT connection.
 [4]- 3-ph, 3-wire, unbalanced load, 3-CT and 2-VT/PT connections
 6A System type selection 3P.1
 [5]- 3-ph, 3-wire, balanced load, 1-CT connection (if the neutral is available the voltage connection can be realized to only 2-wire VL1 and N).
 [6]- 3-ph, 3-wire, balanced load, 1-CT and 2-VT/PT connection.
 6A System type selection 2P
 [7]- 2-ph, 3-wire, 2-CT connection.
 [8]- 2-ph, 3-wire, 2-CT and 2-VT/PT connections
 6A System type selection 1P
 [9]- 1-ph, 2-wire, 1-CT connection.
 [10]- 1-ph, 2-wire, 1-CT and 1-VT/PT connection
 Static output and serial port
 [11]- Opto-mosfet static output
 [12]- RS485 connection 2 wires [a]- last instrument, [b]- instrument 1...n, [c]- RS485/RS232 transducer.
 (*) NOTE For a correct power supply of the instrument, the neutral must always be connected.

SUOMI

- 6A,Verkon tyypin valinta 3Pn
 [1]- 3-v, 4-johd, epäsymmetrisen kuorma, 3 VM kytkevä. [2]- 3-v, 4-johd, epäsymm. kuorma, 3 VM ja 3 JM kytkevä.
 6A,Verkon tyypin valinta 3P
 [3]- 3-v, 3-johd, epäsymmetrisen kuorma, 3 VM kytkevä. [4]- 3-v, 4-johd, epäsymm. kuorma, 3 VM ja 2 JM kytkevä.
 6A,Verkon tyypin valinta 3P1
 [5]- 3-v, 3-johd, symmetrisen kuorma, 1 VM kytkevä. (jos nolla-johdin on kytkevä jännitemittaus otetaan liittimiin: L1 ja N). [6]- 3-v, 3-johd, symmetrisen kuorma, 1 VM ja 2 JM kytkevä.
 6A,Verkon tyypin valinta 2P
 [7]- 2-v, 3-johd, 2 VM kytkevä. [8]- 2-v, 3-johd, 2 VM ja 2 JM kytkevä.
 6A,Verkon tyypin valinta 1P
 [9]- 1-v, 2-johd, 1 VM kytkevä. [10]- 1-v, 2-johd, 1 VM ja 1 JM kytkevä.
 Staatinen lähtö ja sarjaliikenenneportti
 [11]- Opto-mosfet staatinen lähtö
 [12]- RS485 2-johdin kytkevä [a]- viimeinen laite, [b]- laitteet 1...n [c]- RS485/RS232 muunnin.
 (*) HUOM: Nollajohdin täytyy aina olla kytkeväksi takaamaan laitteen oikea syöttöjännite.

DEUTSCH

- 6A Systemwahl: 3Pn
 [1]- 3-ph, 4-Adrig, asymmetrische Last, 3 Stromwandleranschluss. [2]- 3-ph, 4-Adrig, asymmetrische Last, 3 Strom- und 3 Spannungswandleranschlüsse
 6A Systemwahl: 3P
 [3]- 3-ph, 3-Adrig, asymmetrische Last, 3 Stromwandleranschlüsse. [4]- 3-ph, 3-Adrig, asymmetrische Last, 3 Strom- und 2 Spannungswandleranschlüsse
 6A Systemwahl: 3P.1
 [5]- 3-ph, 3-Adrig, symmetrische Last, 1-Stromwandleranschluss (wenn der Nullleiter verfügbar ist, kann der Voltmeteranschluss mit nur 2 Adern VL1 und N vorgenommen werden). [6]- 3-ph, 3-câbles, charge déséquilibrée, connexions 1 TC et 2 TT/TP
 6A Selection du type de réseau: 2P
 [6]- 3-ph, 3-Adrig, symmetrische Last, 1-Stromwandleranschluss und 2 Spannungswandleranschlüsse
 6A Systemwahl: 2P
 [7]- 2-ph, 3-Adrig, 2 Stromwandleranschlüsse. [8]- 2-ph, 3-Adrig, 3-Strom- und 2 Spannungswandleranschlüsse
 6A Systemwahl: 1P
 [9]- 1-ph, 2-Adrig, 1-Stromwandleranschluss. [10]- 1-ph, 2-Adrig, 1-Stromwandleranschluss und 1 Spannungswandleranschlüsse
 Uscite und seriale Schnittstelle
 [11]- Statischer Ausgang mit Opto-Mosfet [12]- RS485-Anschlüsse, 2-Adrig [a]- letzte Gerät, [b]- Gerät 1...n, [c]- RS485/RS232 Umformer.

(*) HINWEIS: Der Neutralleiter muss angeschlossen sein, um eine korrekte Spannungsversorgung des Instrumentes zu gewährleisten.

FRANÇAIS

- 6A Sélection du type de réseau: 3Pn
 [1]- 3 phases, 4 câbles, charge déséquilibrée, connexions 3 TC. [2]- 3 phases, 4 câbles, charge déséquilibrée, connexions 3 TC et 3 TT/TP
 6A Sélection du type de réseau: 3P
 [3]- 3 phases, 3 câbles, charge déséquilibrée, connexions 3 TC. [4]- 3 phases, 3 câbles, charge déséquilibrée, connexions 3 TC et 2 TT/TP
 6A Sélection du type de réseau: 3P1
 [5]- 3 phases, 3 câbles, charge équilibrée, connexions 1 TC (si le neutre est disponible, le branchement voltmétrique peut être réalisé à seulement 2 fils VL1 et N). [6]- 3 phases, 3 câbles, charge équilibrée, connexions 1 TC et 2 TT/TP
 6A Sélection du type de réseau: 2P
 [7]- 2 phases, 3 câbles, connexions 2 TC. [8]- 2 phases, 3 câbles, connexions 3 TC et 2 TT/TP
 6A Sélection du type de réseau: 1P
 [9]- 1 phases, 2 câbles, connexions 1 TC. [10]- 1 phases, 2 câbles, connexions 1 TC et 1 TT/TP
 Sorties et port série
 [11]- Sortie statique en opto-mosfet [12]- Connexion RS485 2 câbles [a]- dernier instrument, [b]- instrument 1...n, [c]- Transducteur RS485/RS232.
 (*) NOTE: Pour une alimentation correcte de l'instrument, le neutre doit toujours être relié.

! The provided current transformers MUST be connected so to match with the measuring inputs, that is CT **I1** with input **I1**, CT **I2** with input **I2** and CT **I3** with input **I3**.

! Edellyttää, että virtamuuntajat ON kytkeytä oikein mittaus-tuloihin, mitkä ovat: VM **I1** n tuloihin **I1**, VM **I2** n tuloihin **I2**, VM **I3** n tuloihin **I3**.

! Die vorgesehenen Stromwandler MÜSSEN so verbunden werden, dass die Eingänge **I1** des CT1 mit **I1**, **C2** mit **I2** und **C3** mit **I3**.

! Les transformateurs de courant doivent OBLIGATOIREEMENT être raccordés de cette manière afin de correspondre aux mesures d'entrées; soit **I1** du TI sur entrée **I1**, **I2** TI sur entrée **I2** et **I3** du TI sur entrée **I3**.

ESPAÑOL

- 6A, selección del sistema: 3P.n
 [1]- Trifásico, 4 hilos, carga desequilibrada, conexión 3 tramos de intensidad.
 [2]- Trifásico, 4 hilos, carga desequilibrada, conexión 3 tramos de tensión/potencia.
 6A, selección del sistema: 3P
 [3]- Trifásico, 3 hilos, carga desequilibrada, conexión 3 tramos de intensidad.
 [4]- Trifásico, 3 hilos, carga desequilibrada, conexión 3 tramos de intensidad y 2 tramos de tensión/potencia.
 6A, selección del sistema: 3P1
 [5]- Trifásico, 3 hilos, carga equilibrada, conexión 1 tramo de intensidad y 2 tramos de tensión/potencia.
 6A, selección del sistema: 2P
 [6]- Bifásico, 3 hilos, conexión 2 tramos de intensidad.
 [7]- Bifásico, 3 hilos, conexión 2 tramos de intensidad y 2 tramos de tensión/potencia.
 6A, selección del sistema: 1P
 [8]- Bifásico, 2 hilos, conexión 2 tramos de intensidad.
 6A, selección del sistema: 1P
 [9]- Monofásico, 2 hilos, conexión 1 tramo de intensidad.
 [10]- Monofásico, 2 hilos, conexión 1 tramo de intensidad y 1 tramo de tensión/potencia.
 Salidas y puerto serie
 [11]- Salida estática opto-mosfet
 [12]- RS485, conexión dos hilos [a]- último instrumento, [b]- instrumento 1...n, [c]- transductor RS485/RS232.
 (*) NOTA: Para la correcta alimentación del instrumento, el neutro debe estar siempre conectado.

! La intensidad suministrada por los transformadores DEBE estar conectada a las correspondientes entradas de medida, es decir: CT **I1** con entrada **I1**, CT **I2** con entrada **I2** y CT **I3** con entrada **I3**.

■ SAFETY PRECAUTIONS

Read carefully the instruction manual. If the instrument is used in a manner not specified by the producer, the protection provided by the instrument may be impaired.
Maintenance: make sure that the connections are correctly carried out in order to avoid any malfunctioning or damage to the instrument. To keep the instrument clean, use a slightly damp cloth; do not use any abrasives or solvents. We recommend to disconnect the instrument before cleaning it.

■ TECHNICAL SPECIFICATIONS

Rated inputs: System type: 3. Current range (by CT) VV2: 90A, VV3: 150A, VV5: 250A. Voltage (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A, V5 model Iref: 20A, Imax: 250A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage in the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency Range: 45 to 65Hz; resolution: ±1Hz Active power: ±(2% RDG + 2DGT). Power Factor: ±(0,001+2%(1,000 - "PF RDG')). Reactive power: ±(3% RDG + 2DGT). Active energy class A according to EN50470-3; class 2 according to EN62053-21. Start up current VV2: 75mA, VV3, VV5: 100mA. Temperature drift: = 200ppm/°C @ PF=1. Phase error: = 0,05°C. Sampling rate: 1600 samples/s @ 50Hz; 1000 samples/s @ 60Hz. Display refresh time: 1 second. Display: 2 lines 1st line: 7-DGT, 2nd line: 3-DGT or 1st line: 3-DGT + 3-DGT, 2nd line: 3-DGT. Type LCD, h 7mm. Instantaneous variables read-out 3-DGT. Energies: imported, Total: 6+1DGT (or 7 DGT). Overload status EEE indication when the value being measured is exceeding the "Continuous inputs overload" (maximum measurement capacity). Max. and Min. indication: Max. instantaneous variables: 999; energies: 999 999.0 or 9 999 999 (positive only). The negative energy is neither metered nor subtracted. Min. instantaneous variables: 0; energies 0.0. LEDs: Red LED (Energy consumption) 0.01 kWh by pulse if VT ratio is <4 (VV2) or <2 (VV3 or V5). 0.1 kWh by pulse if VT ratio is <40 (VV2) or <23 (VV3 or V5). 1kWh by pulse if VT ratio is >40 (VV2) or >23 (VV3 or V5). Max frequency: 16Hz, according to EN50470-3. Green LED (on the terminal blocks side) for power on (steady) and communication status: RX-TX (in case of RS485 option only) blinking. Measurements: Method TRMS measurements of distorted wave forms. Coupling type: by means of external CTs. Crest factor: 3 (VV2: 230A max. peak). Current Overloads: without valid measurement. Continuous VV2: 120A, VV3: 300A, VV5: 360A. Voltage Overloads: continuous 1.2 Un. For 500ms 2 Un. Voltage input impedance: self-power supply power consumption: <2VA. Frequency: 45 to 65 Hz. Key-pad: two push buttons for variable selection and programming of the instrument working parameters. Pulse output Number of outputs 1. Type programmable from 0.01 to 9.99 kWh per pulses. Output connectable to the energy meters (kWh). Pulse duration ≥100ms < 120ms (ON), ≥120ms (OFF), according to EN62052-31. Output Static: opto-mosfet. Load V_{ON} 2.5 VAC/DC max. 70 mA, V_{OFF} 260 VAC/DC max. Insulation by means of optocouplers, 4000 VRMS output to measuring inputs. RS485 type Multidrop, bidirectional (static and dynamic variables). Connections 2-wire. Max. distance 1000m, termination directly on the instrument. Addresses 247, selectable by means of the front keypad. Protocol MODBUS/JBUS (RTU). Data: Dynamic (reading only) single phase and system values. Static (reading and writing). All the configuration parameters. Data format 1 start bit, 8 data bits, no parity, 1 stop bit. Baud-rate 9600 bits/s. Driver input capability 1/5 unit load. Maximum 160 transceivers on the same bus. Insulation by means of optocouplers, 4000 VRMS output to measuring input. Transformer ratio: VT (PT) 1.0 to 99.9 / 100 to 999 / 1.00k to 6.00k CT: fixed primary: 90, 150 or 250A. The maximum power being measured cannot exceed 210 MW calculated as maximum input voltage and current. Operating temperature -20°C to +50°C (-13°F to 131°F) (R.H. from 0 to 90% non-condensing @ 40°C). Storage temperature -30°C to +70°C (-22°F to 158°F) (R.H. <90% non-condensing @ 40°C). Installation category Cat. III (IEC60664, EN60664). Insulation (for 1 minute) 4000 VRMS between measuring inputs and digital output. Dielectric strength 4000 VRMS for 1 minute. Noise rejection CMRR 100 dB, 48 to 62 Hz. EMC According to EN62052-11. Electrostatic discharge 15kV air discharge; Immunity to irradiated test with current: 10V/m from 80 to 2000MHz; Electromagnetic fields test without any current: 30V/m from 80 to 2000MHz; Burst on current and voltage measuring inputs circuit: 4kV. Immunity to conducted disturbances 10V/m from 150kHz to 80MHz. Surge on current and voltage measuring inputs circuit: 6kV; Radio frequency suppression according to CISPR 22. Standard compliance: safety IEC60664, IEC61010-1 EN60664, EN61010-1 EN62052-11. Metrology EN62053-21, EN62053-23, EN50470-3. Pulse output DIN43864, IEC62053-31. Approvals: CE. Connections: Screw-type. Cable cross-section area: 2,4 x 3,5 mm. Min./Max. screws tightening torque: 0,4 Nm / 0,8 Nm. Housing: dimensions (WxHxD) 72 x 72 x 65 mm. Material Noryl PA66, self-extinguishing: UL 94 V-0. Mounting: panel and DIN-rail. Protection degree: front IP50. Screw terminals: IP20. Weight: approx. 400 g (packing included). Self power supply 18 to 260VAC (48-62Hz) (VL1-N). Power consumption: = 20VA/1W.

UL NOTES

"Max. Surrounding Air of 40°C". "Use 60 or 75°C copper (Cu) conductor and wire size No. 24-12 AWG, stranded or solid".

■ TURVALISUUSOHJEET

Lue ohjekirja huolellisesti. Jos laitteita käytetään valmistajan ilmoittamien teknisten tietojen vastaisesti, sen suojaus voi heikentyä.
Huolto: varmista, että kaikki kytkennit on tehty oikein virhe-toimintoon ja laitteen viakaantumisen välttämiseksi.
Käytä laitetta puhdistamassa pehmää liinaa; älä käytä hankaavia aineita tai liuottimia. Katkaise laitteen syöttöjänne aina ennen puhdistusta.

■ TECHNICAL SPECIFICATIONS

Nimellistulot: Verkon typpi: 3. Virtamuuntajien (VM) virta-alueet: VV2: 90A, VV3: 150A, VV5: 250A. Jännite (suoraan tai JM) VVx: 400VLL. **Tarkkuus** (Näyttö+RS485) Iref: se要看; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage in the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RDG + 1DGT). Frequency (direct or by VT/PT). VVx: 400VLL. Accuracy (Display + RS485) Iref: see below; Un: see below (@25°C ±5°C, R.H. = 60%, 48 to 62 Hz). Voltage range VVx model Un: 160 to 260VNL (277 to 450VLL). Current range VV2 model Iref: 15A, Imax: 90A, V3 model Iref: 20A, Imax: 150A. Current From 0,05ref to 0,1ref: ±(1% RDG + 3DGT). Phase-neutral voltage In the range Un: ±(0,5% RDG + 1DGT). Phase-phase voltage In the range Un: ±(1% RD